

Case 1 1
Case 2 1
Case 3 1
Case 4 1
Case 5 2

ErrorCode : -21070

× -21070 (Homming Start Timeout)
가 가 .

Case 1

- Homing Method
- Homing Method
 - 0x60E3:1 - 30 (Supported Homing Methods)

Case 2

- PDO Map "Modes of Opeation"
-

Case 3

- Homing Speed (0x6099), Homing Acceleration(0x609A) 0
- Homing Speed (0x6099) Homing Acceleration(0x609A)
- ecmHomeCfg_SetSpeedPatt()

Case 4

- Max motor speed (0x6080) 0 ¹⁾
- 0x6080:0 0 (3000)
- ecmSxCfg_SetMaxSpdOfCT() MaxSpd 3000 ²⁾

Case 5

- (-) 가
- (-) (NOT)
- **POT** 가 (+)
- -21070 (Homming Start Timeout)
- POT .
- POT OFF

¹⁾

Omron 0x607F (Max Profile Speed)

²⁾

Omron 0x607F ecmSxCfg_SetMaxProfSpdOfCT()

From:

<https://www.comizoa.com/info/> - -

Permanent link:

https://www.comizoa.com/info/doku.php?id=platform:ethercat:100_api:5_errorcode:21070&rev=1624430390

Last update: **2024/07/08 18:22**